


## Pt100 sensor with handle FPA 106 LxxxxH

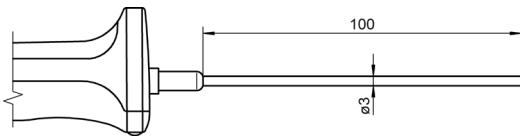


Accuracy: Pt100 film resistor, class B\*  
 Measuring tip: Operative range -40...+400 °C  
 Sheath element, stainless steel  
 $T_{90}$ : \* 8 s  
 Handle: \* 127 mm  
 Cable: 1.5 m FEP/silicone

L = 100 mm      **Order no. FPA106L0100H**

For immersion measurement

## Pt100 sensor with handle FPA 123 LxxxxH

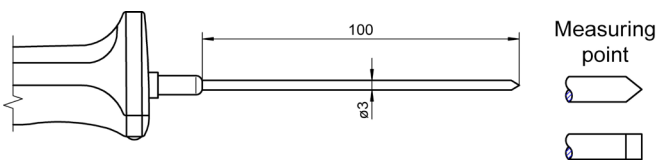


Accuracy: Pt100 film resistor, class B\*  
 Measuring tip: Operative range -40...+400 °C  
 Penetrating tip  
 $T_{90}$ : \* 8 s  
 Handle: \* 127 mm  
 Cable: 1.5 m FEP/silicone

L = 100 mm      **Order no. FPA123L0100H**

For immersion measurement in plastic and pasty substances

## Pt100 sensor with handle FPA 124 LxxxxH

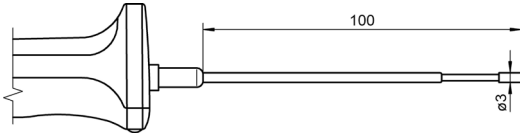

Accuracy: Pt100 film resistor, class B\*  
 Measuring tip: Operative range -40...+300 °C  
 Silver rivet, level  
 $T_{90}$ : \* 10 s  
 Handle: \* 127 mm  
 Cable: 1.5 m FEP/silicone

L = 100 mm      **Order no. FPA124L0100H**

For surface measurement and immersion measurement